

Hydrologic Investigation of Concrete Flood Control Channel at UC Berkeley's Richmond Field Station

by Patrick Nichols

Abstract The Richmond Field Station Natural Restoration Project is a five year multimillion dollar effort. The first stages involve the remediation of polluted marsh lands, then the restoration of the upland prairie habitat, finishing with the adjacent channel. The concrete flood control channel is slated to become a free flowing creek and riparian corridor by the restoration planners at the university. The dynamics of this system must be understood to properly design a restoration, or creation plan since historically no creek existed there. This study assesses multiple aspects of the concrete channel to determine its health and qualifications for restoration. We calculated flow measurements at various intervals along the channel using velocity observations and the known cross sectional areas. We observed the depths creating a predictive relationship between depth and flow. Water quality characteristics: dissolved oxygen, turbidity, and conductivity were measured on a weekly basis for three months during the winter/spring of 2004. This information is used to help answer the question of what is the health of this system with regards to these variables, and what are its hydrological characteristics. Results show a consistent base flow of about 1 cubic foot per second with a peak flow around 152cfs. A linear relationship exists between depth and flow. The slope of the channel water surface is about 0.36%. The water quality parameters were indicative of a healthy system. The results of this project provide a base of knowledge for future investigation.

Introduction

Anthropogenic activity has had irreversible affects on almost every water shed system in the United States if not the world (The Federal Interagency Stream Restoration Working Group 1998). It has been known for some time that human influences have enormous impacts on these systems, “Human activity has profoundly affected rivers and streams in all parts of the world, to such an extent that it is now extremely difficult to find any stream which has not been in some way altered, and probably quite impossible to find any such river.” (Hynes 1970). This holds true for most water bodies, especially estuaries and bays with large metropolises relying on them like the San Francisco Bay. It has been estimated that the bay is only two thirds the size it was before European descendents began damming, diking and filling (Save The Bay website 2004). Since the seventies there has been an increasing movement to protect and restore the vital habitat of the urban streams, their riparian corridors, and associated wetlands. (Schwartz 2000)

The UC Berkeley owned Richmond Field Station (RFS) in Richmond, California just north of Berkeley (see location map appendix A), is the center of a five-year plan of remediation and restoration. The plan is centered around Stege marsh, and addresses property partially owned by UC Berkeley, East Bay Regional Parks and a private brown-field development company (A.M. 2003, pers. comm.). The marsh has had a long and complex history of pollutant loading (URS Greiner *et al.*1999). Cinder pyrite dumping combined with the sedimentation from the watershed and creation of jetties long ago converted a former mudflat into a tidal salt marsh. The marsh, now known as Stege Marsh, was loaded with toxins from a combination of by-products from the mercury fulminate facility and the explosive and industrial chemical production located there. In

1997, the area was designated a toxic hot spot by the Bay Protection and Toxic Cleanup Program, which mandated a clean up by the property owners. The concentrations of many pollutants in the marsh were higher than EPA standards, by several orders of magnitude, such that it required a major operation to remediate the toxic conditions. The University chose to remediate and restore the marsh in order to create and preserve some optimal habitat for many species including the endangered Clapper rail (*Rallus longirostris obsoletus*) and salt marsh harvest mouse (*Rerthrodontomys raviventris*).

Stege Marsh, bordered by a portion of upland prairie habitat also being restored, has three fresh water inputs and tidal influence from the San Francisco Bay. One of the fresh water sources, Baxter creek, enters from the southeast. On the northwest side there is Meeker creek and an unnamed concrete lined channel (S.F. 2003, pers. comm.). This trapezoidal concrete lined flood control channel runs adjacent to a large portion of the upland prairie habitat slated for restoration, and is the focus of this research. The long-term restoration plan for the property includes restoring this channel to a “natural” creek setting using/demonstrating various bioengineering technologies that have been successful at restoring riparian habitat (Nolan & Guthrie 1998). This “natural” creek restoration is unique because it essentially would create a creek where there was not one historically. The riparian habitat would transition to the adjacent upland prairie habitat and into the marsh and slough area.

At the beginning of this project very little was known about this channel, except that it appeared in historical aerial photographs around the 1940’s, and did not exist before then. The planners knew nothing about its exact origin, its flow rate, capacity, water quality etc. (S.F. 2003, pers. comm.)

The objectives of this study were to measure discharge and sample water quality in the channel at regular intervals over the 2004 winter-spring runoff period, and to survey channel geometry, to characterize the hydrology, water quality, and channel form to inform efforts to "restore" this channel to a more natural condition. The system can then be analyzed for ecological health according the EPA standards for dissolved oxygen, conductivity and pH for creek systems in this region. (EPA Website 2004)

With this information a restoration plan for the creek can be devised and implemented in the years to come. These different parameters are extremely important to know, especially flow rate, volume and water quality in order to understand the dynamics of the creek and create the optimal vision for restoration (Kondolf 1990). Every hydrological system is unique in so many ways that it is very important to discover everything possible about the system before devising a plan to transform it to an aesthetically more natural setting (Kondolf 1998).

Methods

Our baseline data collection, as recommended for any stream restoration project by the Federal Interagency Stream Restoration Working Group (1998), involved: (1) acquiring maps of the channel and all the storm drain connections to determine the size and location of its drainage basin, (2) taking flow rate/volume measurements after key storm events and throughout winter/spring 2004 to document its flow regime, (3) conducting hydrologic level surveys based on Dunne and Leopold (1978) and Gordon et al. (1992) and (4) simultaneously documenting some water quality parameters at selected points along the creek: (a) measuring conductivity because it is very important to the

salting out effect of nutrients at the fresh water/salt water interface; (b) turbidity and (c) dissolved oxygen; d) recording pH, temperature, and salinity because of their impact on the types of biota that can survive in the water once restored (Horne & Goldman 1994). We chose three sites along the concrete channel to collect flow and water quality data. We collected data randomly through February, March, and April 2004. We sampled at three sites: one where the channel surfaces from an underground culvert, one along the main stem of the channel and one near the mouth of the channel where it empties into Stege marsh (see sketch map appendix A). We conducted a level survey to measure the slope of the land and water surface required for estimating channel flow and designing creek form.

The following data collection was performed:

- Using the storm drain/flood control maps, and topographic information in conjunction with the hydrological data, we calculated the drainage area and land use for the catchment of this channel. We used this data to estimate peak flows of the major storm events that only occur at various long-term intervals (i.e.: 50 and 100 year flood events)
- Flow data randomly over ten weeks and around big storm events, avoiding times when tides were high enough to affect the channel. This provided data at the three sites for each collection time. A commonly used low-tech flow measurement method was employed. The low-tech method involved the use of orange peels and timing their travel over a set distance of the channel with a stopwatch (Dunne & Leopold 1978). See appendix A for calculations.

- Six important water quality parameters: pH, turbidity, dissolved oxygen, temperature, salinity and conductivity. This collection occurred on each sampling day at each site using a Horiba U-10 water quality multi-meter.
- Conducted survey of longitudinal profile using a surveyors level and rod at 100m intervals. We collected elevations of the thalweg and water surface.
- Conducted surveys of three cross sections of the channel at the sites where flow and water quality data collection took place.

The flow data was averaged over the three sites as replicates then plotted by time, to show the pattern of flow during the course of the study, as well as for assessing average and peak flows (Dunne & Leopold 1978). Average flow was also plotted by the amount of rainfall within 24 hours of data collection, estimated from precipitation data on the NOAA website (2004), in order to understand how the watershed responds. The average depths were plotted with the associated average flows to create a rough rating curve for the system, so the channel can be gauged and the gauge height (depth) used to easily infer the flows in the future. The distributions including the means and standard deviations of the water quality parameters were analyzed for comparison to expected EPA standards associated with systems in this area as a preliminary proxy for potential ecological health (EPA website 2004), see table 1. Peak flows were estimated following the Rantz method (1971) derived from drainage basins from 0.2 to 196 mi² with average precipitation from 13 to 60 inches, 2-year floods ranging from 5 to 27,000cfs located in the San Francisco Bay area. This system fits into all those categories. For comparison peak flows were also estimated using the Rational Method (Dunne & Leopold 1978), which is not

recommended for basins larger than 200 acres like this one (see appendix A for all calculations).

Results

The drainage area was estimated using a storm drain map from the city of Richmond. This map yielded a drainage area of approximately 1,624 acres, 2.54 square miles (see appendix A). The maps showed us that the land use of the drainage area is approximately 50% industrial and 50% residential. The average annual rainfall is 23.19 inches (Western Regional Climate Center 2004). This information was used to calculate approximations for expected peak flows. In order to get the range of possibilities we estimated peak flows with the Rational Method and Rantz method, the latter of which is most applicable to this type of system. The Rantz method estimated peak flow for the 2-year storm around 104cfs, for the 10-year storm around 369cfs and for the 50-year storm a peak around 824cfs. The Rational Method estimated a peak flow for the 10-year storm around 892cfs, around 1137cfs for the 50-year storm and a peak flow around 1223cfs for the 100-year storm. See appendix A for all calculations.

The surveying concluded that the channel has a slope of approximately 0.36% and a length of 1660.21ft from the culvert opening to the point at which it meets the marsh. The cross sections show a uniform shape over most of the channel (appendix A). The long profile reveals the channel does not slope evenly and flattens out in places creating deeper water, which we observed when walking the channel (fig 1).

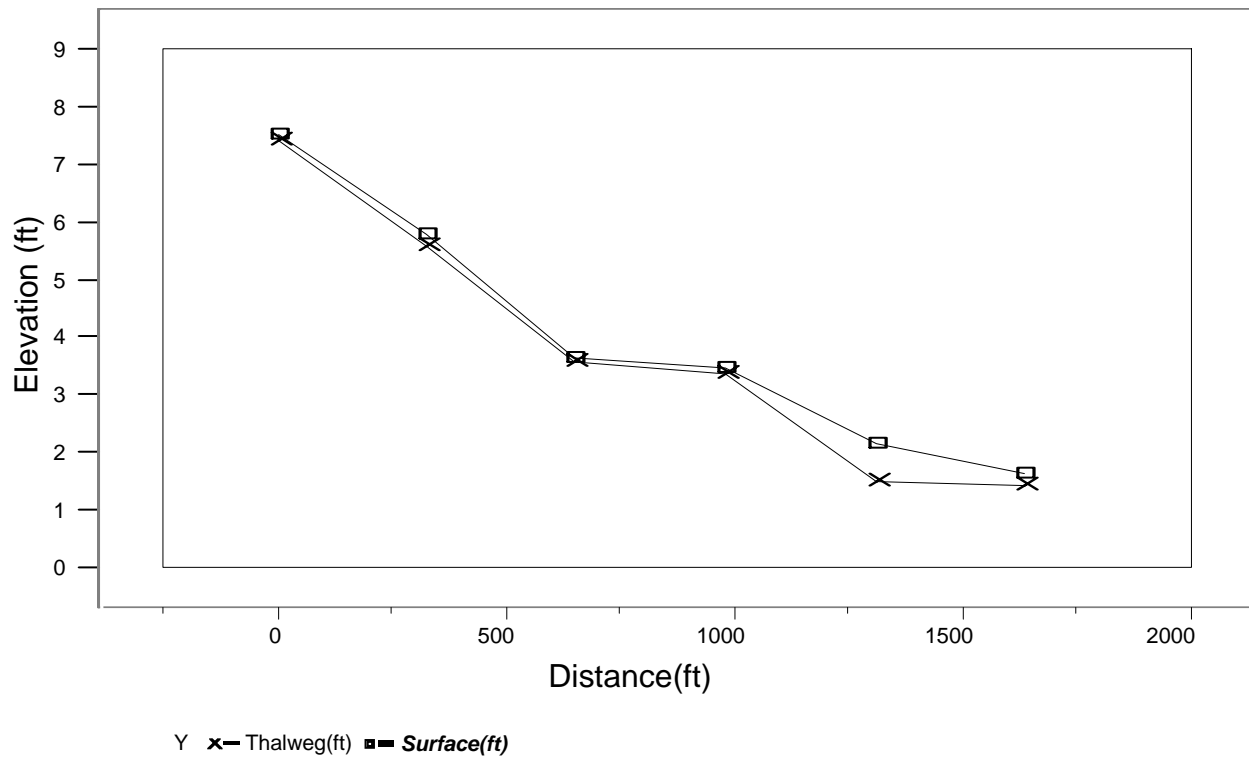


Fig. 1: Longitudinal Profile

The flows peaked out at 153 cfs during the largest storm event of the season (fig. 2). Pre-wet season observations showed that this system seems to have a consistent base flow of approximately 1cfs (fig. 2).

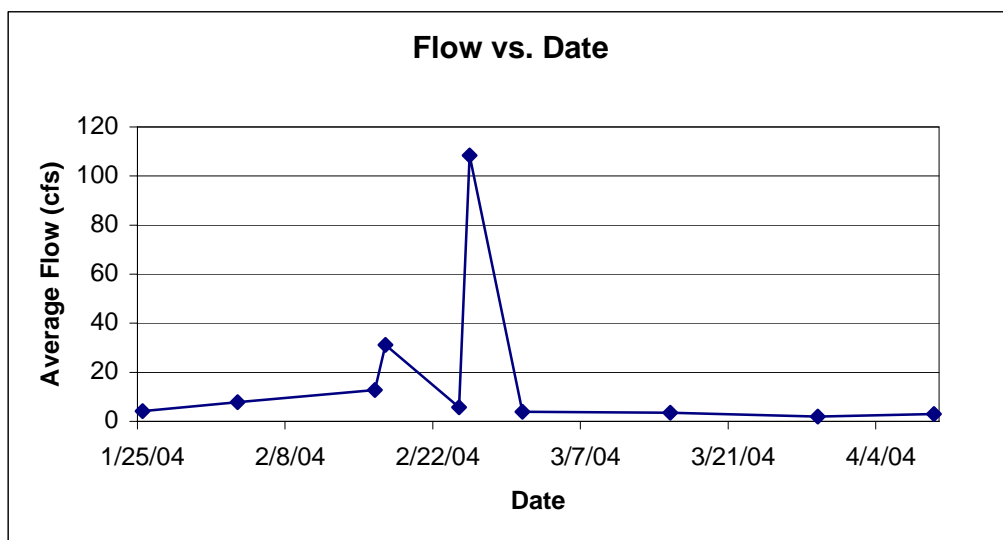


Fig. 2 : 2004 winter-spring season hydrograph.

We observed a strong correlation between the depth of the water and the flow (fig 3). This made it possible to apply a linear regression as an approximate rating curve. Once gauged, flow can be estimated using the linear formula: Average Depth (in) = $3.9165667 + 0.1415054$ Average Flow (R^2 : 0.84).

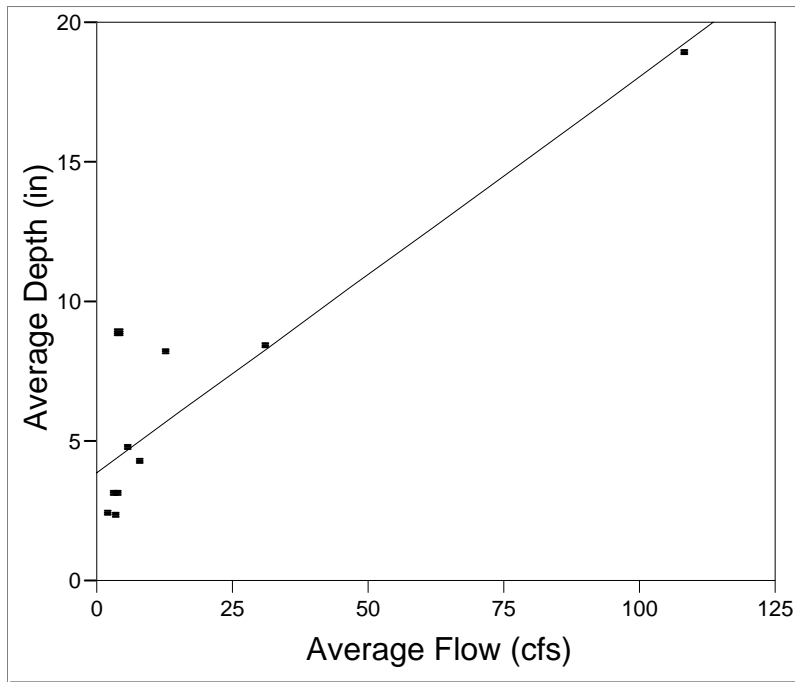


Fig. 3: Rating Curve, Linear Fit of Depth (in) by Flow (cfs)

Visual observations of the channel through the course of our study included sighting an unidentifiable fish in the channel. Many waterfowl were observed using the channel for refuge, frogs/toads of some sort were heard, and what appeared to be amphibian eggs were seen. The channel exploded with submerged and emergent vegetation/algae during the spring.

The temperature ranged from 12.7°C – 17.9°C with a mean of 14.4°C. The pH averaged 7.65, which is about neutral indicating no acidic or alkaline problems. The dissolved oxygen (DO) averaged 9.19mg/l with a standard deviation of 2.20 mg/l. Conductivity was in the expected range with a mean of 0.239 mS/cm and a standard

deviation of 0.136 mS/cm. The turbidity had a wide range of variance, and increased greatly during high flows, as expected. The max was 125 NTU during the largest storm event and during the low flow it got as low as 2 NTU. The average was 61.6 NTU with a standard deviation of 48.2 NTU. Salinity was quite low throughout the study as expected for a fresh water system. All values shown in table 1.

Parameter	pH	Conductivity (mS/cm)	Dissolved Oxygen (mg/l)	Turbidity (NTU)	Temperature (° C)	Salinity (%)
Mean	7.9	0.371	11.7	61.6	15.8	0.017
Std. Dev.	0.78	0.172	3.90	48.2	2.92	0.029
EPA Standard	6 – to- 8	0.150 –to- 0.5	9.65 –to- 10.76	NA	NA	NA

Table 1: Water quality parameter means and standard deviations with EPA standards when applicable.

Discussion

The data suggests that this could be considered a healthy system with respect to pH, conductivity and dissolved oxygen as seen in table 1. Although lined with concrete this channel does not seem to have any major problems with these simple water quality parameters when compared to expected EPA standards for a system of this type and area. Temperature and salinity do not appear to be beyond any thresholds for biota (Horne & Goldman 1994). Having a constant base flow is very important for a riparian system, this system appears to have a base flow around 1 cfs during the wet season. This base flow divided by drainage area gives a blaaah of 0.39 cfs/mi^2 which does not seem unreasonable when compared to Wildcat Creek, a restored system in north Richmond, which had a blaaah of 0.47 cfs/mi^2 in 1994 (a relatively dry year) and a blaaah of 1.3 cfs/mi^2 in 1995 (wet year) (USGS 1995). Already supporting an apparently healthy ecosystem, with thriving aquatic biota and avian presence this channel appears as though

it could be successful as a stream corridor. During the study we observed the channel exploding with submergent and emergent vegetation/algae during the spring. Many waterfowl were observed using the channel for refuge, as well as a few small fish. Frogs/toads of some sort were heard and what appeared to be amphibian eggs were seen. The fact that this channel already has a thriving aquatic ecosystem implies that it would be a great candidate for riparian creation. It should also be noted that while this study was focused on the system as a fresh water input to the salt marsh, so no measurements of tidal effect were taken, the tide from the bay was observed influencing the channel over 740 feet up from the marsh, indicating that section of the channel is part of the tidal marsh itself.

Due to the limitations of the equipment various water quality parameters, such as nitrogen, phosphorus, and heavy metal levels that are important to the successful restoration of the system could not be attained (TFISRWG 1998).

The data collected provides a graphical representation of the flow dynamics during the 2004 winter-spring season as the first analysis of the hydrologic character of the channel. The quality of this system can not factually be determined by these results, as it is extremely limited by only being collected during one wet season, and the enormous variability's, seasonal and yearly, of stream systems (Dunne & Leopold 1978). We can use this season as a proxy for an average season, and a first step in the complete analysis spanning many years. This certainly does not produce the most accurate representation possible, as a flow meter and/or hydrological gauge permanently placed in the channel could collect continuous flow data and give you the exact flow dynamics of the system.

The data definitely provides an insight to the dynamics and a starting point for further collection of data in order to devise a unique restoration plan specifically for this system.

The flow plotted by the rainfall fallen in the area with in 24 hours of the data collection (NOAA Weather Page 2004) shows a quick response to precipitation and high discharge associated with less then 2 inches of rain fig. 4.

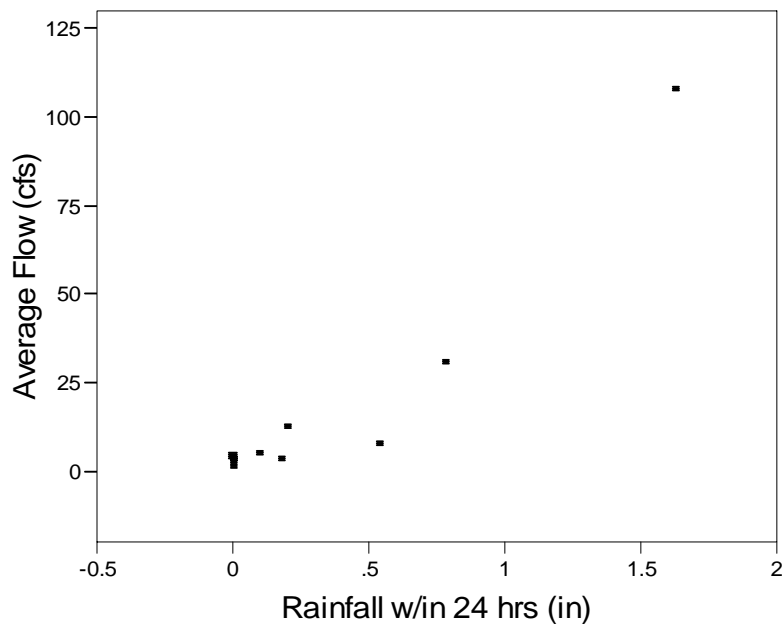


Fig 4: Average flow response to rainfall w/in 24 hours.

This association could be better explained with the installation of an onsite rain gauge, and a stage gauge in the channel recording continuously. The water quality parameters indicate that this is a healthy stream with respect to the variables collected in this project according to the EPA (EPA Website 2004). The large variation in turbidity can be explained by its association with flow, as one would expect larger flows during storms carry much more sediment (fig. 5). Very little sediment was observed in the channel so we must assume it is all being carried to the slough and marsh where it is deposited.

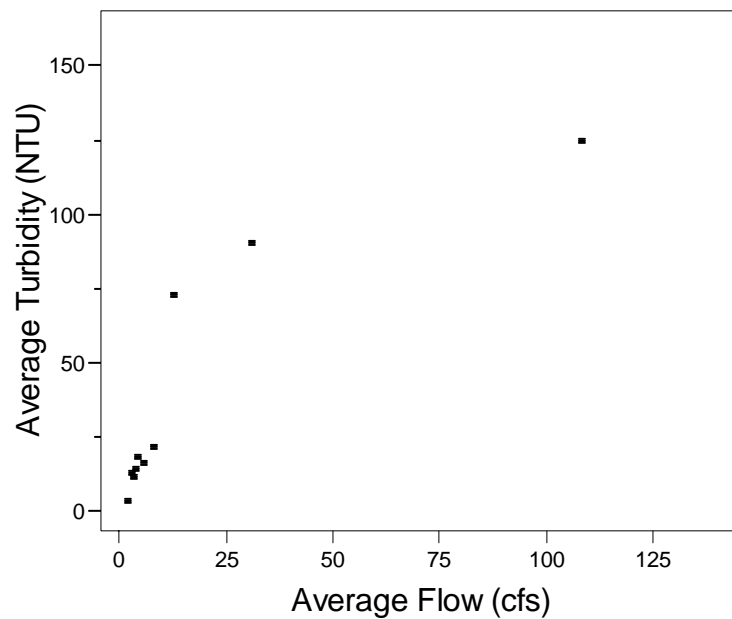


Fig. 5: Turbidity explained by discharge.

Conclusion

This channel should be considered to be a good candidate for restoration with respect to the parameters we investigated (See table 1). The baseline data collected in this study will hopefully be used for future research of the system including multi year discharge analysis and quality characterization. This baseline data collection is just a small piece of the puzzle because it only represents the channel during the small snap shot in time during which we sampled.

More research is needed on this system before any project can begin. Further water quality indicators should be tested such as nitrogen, phosphate, heavy metals and PCB levels, etc. Monitoring should be continued to get a more accurate representation of the flow dynamics over the course of many years. Installing a stage gauge and an onsite rain gauge so the depth could be monitored 24 hours a day would also aid in documenting flow for all events in the system for long time assessment.

This project may go well beyond the scope of this school year as it will need quite a large amount of energy and time to complete the restoration/creation of the creek, and the marsh is not scheduled to be completely remediated for another 3-4 years. We are lucky

enough to get involved at the beginning of the data collection of the channel, but we are hoping to be involved beyond this study and the baseline data to someday see the channel created in to a man-made 'natural' creek with riparian habitat.

Acknowledgments

Special thanks to Courtney Davis for all her help through this project. Thanks to: G.M. Kondolf, Anna Moore, Karl Hans, Sharon Ferrell, Stephen Andrews, W.B.N. Berry, The Aquatic Outreach Institute staff, Renata Andrade, John Lotto, Eric Dubinsky, the ES 196 crew, Shanna Anderson and Luis Garcia.

References

- Dunne, T., Leopold, L.B. 1978, Water in Environmental Planning. W. H. Freeman and Company, New York. 796 pp.
- Farrell, Sharon. Executive Director, Aquatic Outreach Institute, Richmond, California. 2003, personal communication.
- Friends of Baxter Creek Home Page, Accessed: 12/01/03.
<http://www.creativedifferences.com/baxtercreek/>
- Gordon N.D., McMahon T.A., Finlayson B.L. 1992. Stream Hydrology. An Introduction for Ecologists. John Wiley & Sons, Chichester. 526pp
- Horne, A.J., Goldman, C.R. 1994, Limnology, 2nd edition. McGraw-Hill Inc, New York. 520 pp.
- Hynes, H.B.N. 1970. The ecology of running waters. University of Liverpool Press, Liverpool, England.
- Kondolf, G.M. 1990. Hydrologic and channel stability considerations in stream habitat restoration. Environmental Restoration. Science and strategies for restoring the Earth. 214-227
- Kondolf, G.M. 1998. Lessons learned from river restoration projects in California. Aquatic Conservation: Marine and Freshwater Ecosystems. 8 (1) 39-52
- Moore, Anna. Project Manager, Environmental Health and Safety, University of California Berkeley, Berkeley, California. 2003, personal communication.

National Oceanic and Atmospheric Administration, National Weather Service Forecast Office, San Francisco Bay/Monterey, Climate Archives for San Francisco and San Jose Web Page. Accessed 5/1/04.

<http://www.wrh.noaa.gov/Monterey/products/SFOWRKBAY>

Nolan, P.A., Guthrie, N. 1998. River rehabilitation in an urban environment: examples from the Mersey Basin, North West England. *Aquatic Conservation: Marine and Freshwater Ecosystems*. 8 (5) 685-700

Rantz, S. E. 1982. Measurement and computation of streamflow: Volume 1. Measurement of stage and discharge. US Geological Survey Water Supply Paper. 2175

Save the Bay Website, Bay Issues Page. Accessed 5/4/04

<http://www.savesfbay.org/campaigns/stopfill/index.cfm>

Schwartz, S. 2000. A Meandering History of Bay Area Creek Restoration. *The Yodeler*, a publication of the Sierra Club. July issue.

The Federal Interagency Stream Restoration Working Group. 1998, revised 2001. *Stream Corridor Restoration, Principles, Processes, and Practices*. GPO Item No. 0120-A; SuDocs No. A 57.6/2:EN3/PT.653. ISBN-0-934213-59-3. Online @

http://www.usda.gov/stream_restoration/newtofc.htm

U.S. Environmental Protection Agency, Monitoring and Assessing Water Quality page, Accessed: 4/8/04, <http://www.epa.gov/volunteer/stream/>


U.S. Geological Survey. 1995 California Hydrological Data Report. STA. 11181390 Wildcat Creek at Vale Road, Richmond CA. Accessed 5/8/04.

<http://ca.water.usgs.gov/archive/waterdata/95/sw/sw11181390.uk2.html>


URS Greiner Woodward Clyde, University of California, Berkeley Richmond Field Station Field Sampling and Analysis Plan and Tiered Risk Evaluation, Unpublished Report for the University of California, Berkeley. Oakland, 1999.

Western Regional Climate Center. Climate Summary Page for Richmond, California. Accessed 4/23/04. <http://www.wrcc.dri.edu/cgi-bin/cliRECTM.pl?carchm>

Appendix A : Maps

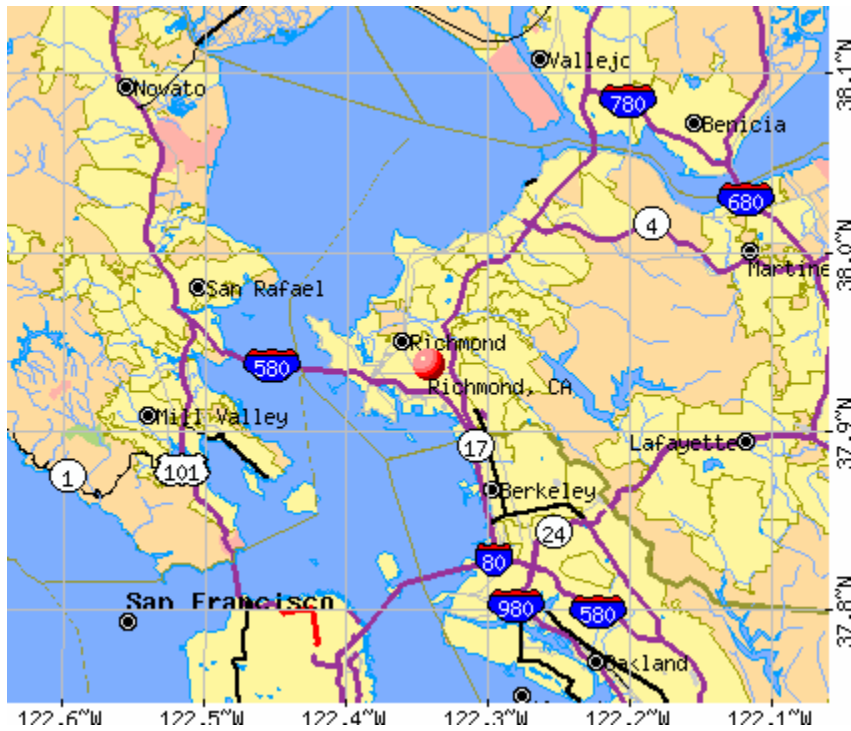

Location Map courtesy of City Data.Com

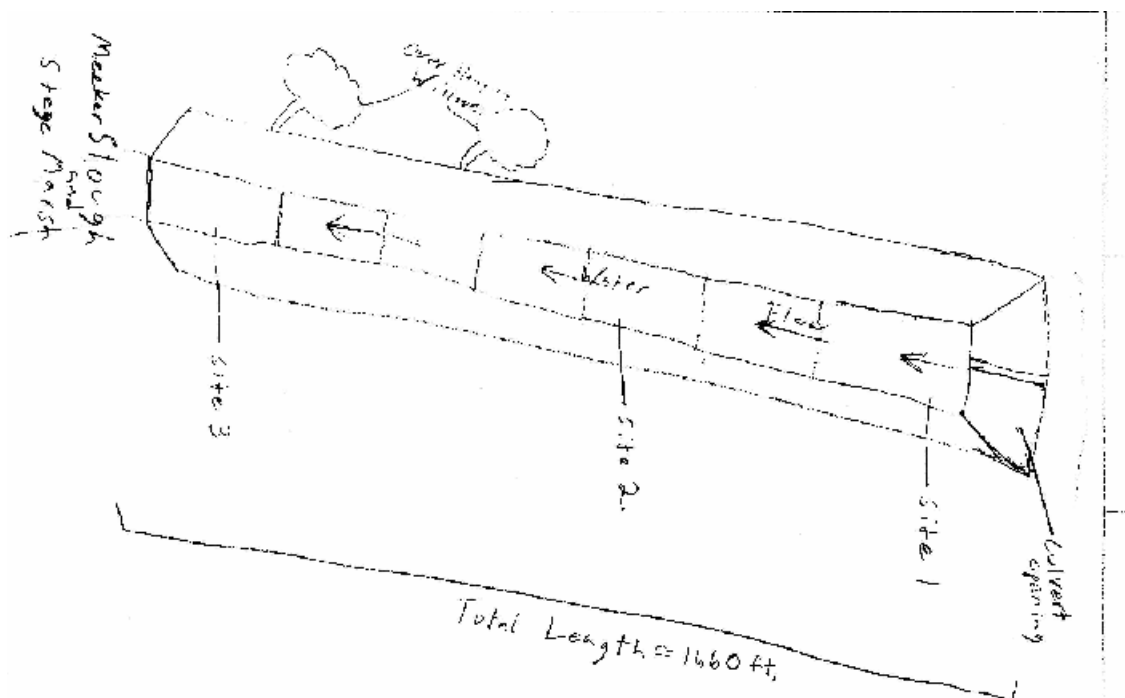

Sketch Map

Appendix A: Calculations

Average Flows estimated by timing velocities of orange peels over a known distance and multiplying by the cross sectional area estimated from the graphed cross sections and measured depths using equation $Q(\text{flow in cfs}) = V(\text{velocity in ft/sec}) * A(\text{cross sectional area in ft}^2)$:

Date	Upper Reach (cfs)	Middle Reach (cfs)	Lower Reach (cfs)	Average Flow (cfs)	Rainfall w/in 24hrs (in)
1/25	2.75	3.87	6.09	4.24	0
2/16	7.5	9.50	21.2	12.7	0.2
2/17	20.72	29.7	42.9	31.1	0.78
2/3	3.61	9.40	10.6	7.87	0.54
2/24	9.28	4.25	3.60	5.71	0.1
2/25	131	106	87.9	108	1.63
3/1	4.23	3.92	3.58	3.91	0.18
3/15	3.58	2.41	4.76	3.58	0
3/29	1.74	2.02	1.95	1.90	0
4/9	1.5	2.73	4.83	3.02	0

Water Shed Estimates were done using a storm drain network map from the City of Richmond Department of Public Works Division of Engineering.

Scale: 1 inch = 400 feet

Drainage Area: on map = $442 \text{ in}^2 = 7.07 \text{ e } 7 \text{ ft}^2 = 1624 \text{ acres} = 2.54 \text{ mi}^2$

Land Use : 50% Industrial 50% Residential

Average Annual Precipitation: 23.19 in

Peak Flow Estimates:

Haltiner's Order of Magnitude ~ $Q_{100}(\text{cfs}) = (0.5\text{-to-}1.0) (\text{drainage area in acres})$

$Q_{100} = (0.5\text{-to-}1.0) (1624 \text{ acres}) = 812 \text{ cfs -to- } 1624 \text{ cfs}$

Rantz Method ~

$Q_2 = (0.069)A^{0.193}P^{1.965} = (0.069)(2.54^{0.193})(26.9^{1.965}) = 104 \text{ cfs}$

$Q_{10} = (7.38)(2.54^{0.922})(23.19^{0.928}) = 369 \text{ cfs}$

$Q_{50} = (69.6)(2.54^{0.847})(23.19^{0.511}) = 824 \text{ cfs}$

Rational Method ~

Concentration time (Dunne & Leopold) $t_c = L^{1.15}/7700(H^{0.38})$

$L = 15100 \text{ ft}$

$H = 300 \text{ ft}$

$t_c = 0.95 \text{ hr} \sim \sim$

Rainfall intensity I (in/hr) from Rantz (1971)

$I_{10} = 0.785$

$I_{50} = 1.0$

$I_{100} = 1.075$

Rational Runoff Coefficient C from Dunne & Leopold (1978)

$C = 0.70$

Rational Method Equation

$$Q \text{ (cfs)} = C I A$$

Appendix A: Calculations continued.

Rational Method Computations

$$Q_{10} = (0.70)(0.785)(1624) = 892 \text{ cfs}$$

$$Q_{50} = (0.70)(1)(1624) = 1137 \text{ cfs}$$

$$Q_{100} = (0.70)(1.075)(1624) = 1223 \text{ cfs}$$

Appendix A: Cross Sections

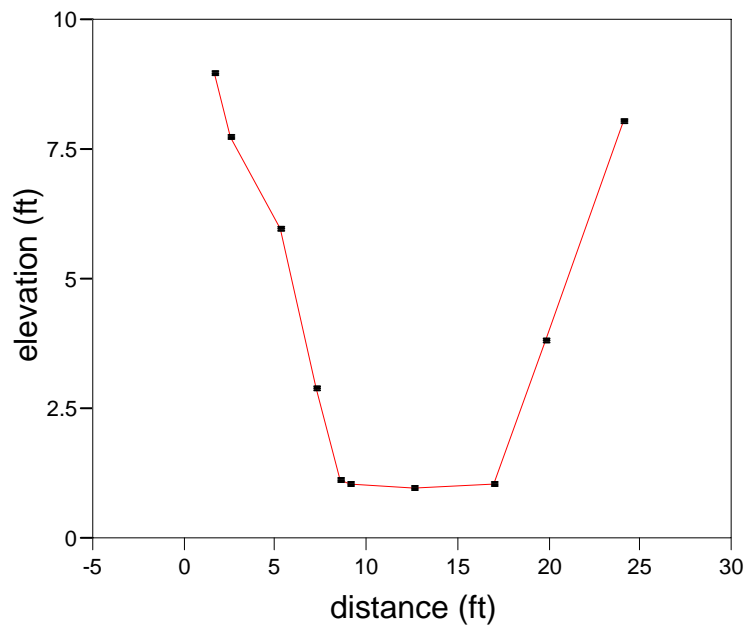


Fig. 1: Cross Section at Site 1

Appendix A: Cross Sections Continued.

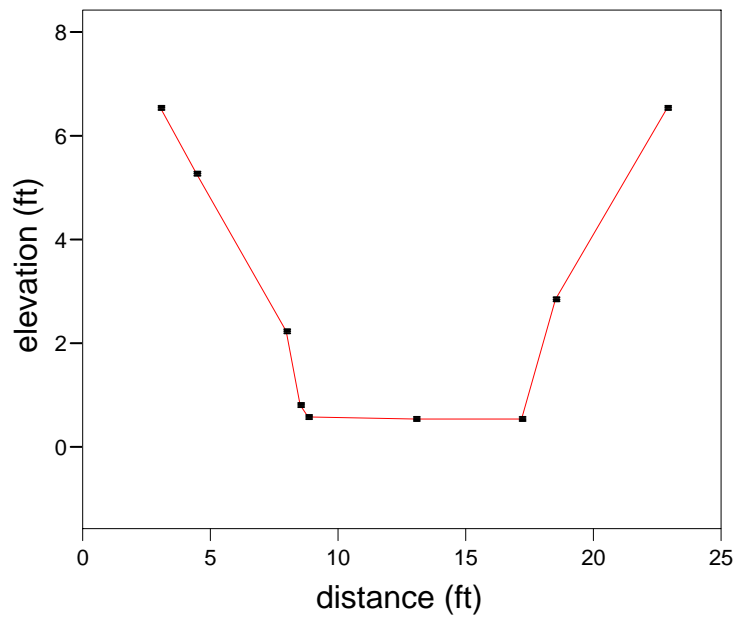


Fig. 2: Cross Section at Site 2

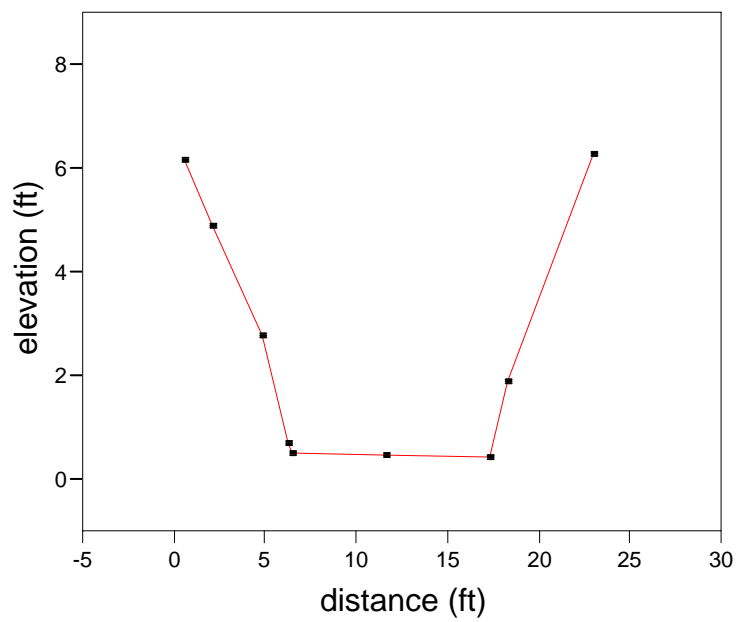


Fig. 3: Cross Section at Site 3.

